


- * Use only cable with cross section 0.75 to 1.50mm² of type H05W-F.
- * Prepare wires according to the 'Wire Detail' view at lower left portion of this document.
- * Insert wires into appropriate terminal locations as demonstrated in the "Wiring View" drawing in the lower left corner. Tighten terminal screws with 0.4 to 0.5Nm (3.5 to 4.4inlb) of torque.
- * Place strain relief over cable, position as shown in the wiring view, and alternately tighten screws until strap adequately hold cable in place, preventing pull-out. Do not over-tighten causing stripped threads or breakage of the strap.
- * Replace cover and secure to a snug fit.

WIRING VIEW –
Inside

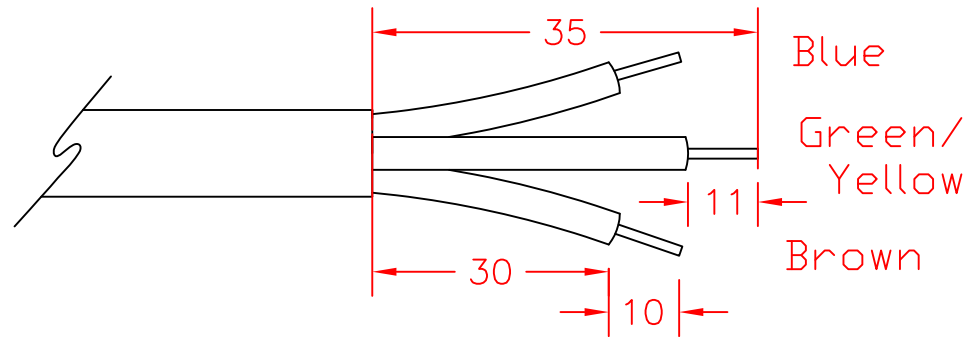

WIRE DETAIL
NOT TO SCALE

THIS DOCUMENT AND ITS CONTENTS ARE THE PROPRIETARY CONFIDENTIAL PROPERTY OF INTERPOWER CORPORATION. NO USE OR COPIES MAY BE MADE WITHOUT WRITTEN PERMISSION FROM INTERPOWER CORPORATION.

DIMENSIONS IN MILLIMETERS

TITLE Wiring Instruction for 88040220

DRAFT BY: JPC DATE: 08/04/11

PART NUMBER: WI88040220

DRAFTING APPROVAL: DATE:

MATERIAL:

DO NOT SCALE

INTERPOWER CORPORATION

SHEET 1 OF 1

REV	CHANGE DESCRIPTION	DATE	INITIALS
A	Introduction of document.	8/4/11	JPC