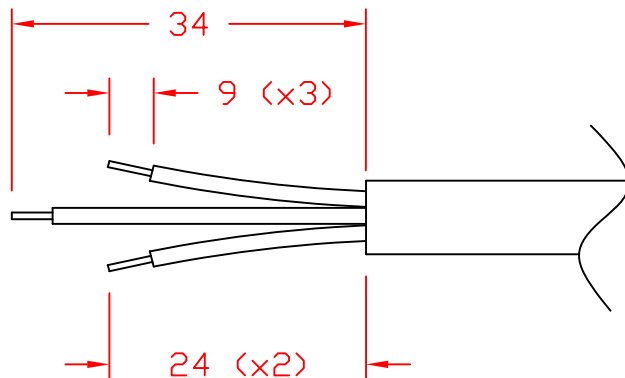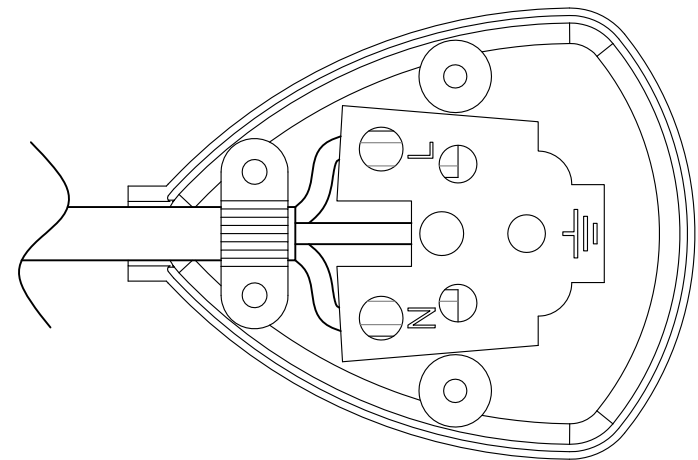NOTES:

1. CABLE SIZE: 1.50mm squared PVC max. (Max. cable diameter of 10mm). Cable of sizes 0.75mm squared PVC and rubber, or 1.00mm squared PVC and rubber are acceptable for use. Max. cable O.D. is 10mm. Use only 3 wire cable with this product.

2. Prepare wires per the "Wire Preparation" drawing below.

3. Insert wires into the appropriate terminal locations as demonstrated in the "Wiring Diagram" below.

4. Place cable in the cable channel and install cable clamp over the cable. Tighten until the jacket is compressed slightly. When installing clamp, ensure that the cables outer jacket extends beyond the clamp in order to prevent damge to conductors.

5. Replace cover and secure.

6. Do not over tighten screws, which could cause stripping of the threads.

7. TORQUE RECOMMENDATIONS: Terminals = 0.9Nm (8inlb) ; Cable clamp = Finger tighten until jacket is slightly compressed; cover screws = finger tight.

WIRE PREPARATION

WIRING DIAGRAM

DIMENSIONS IN MILLIMETERS			TITLE:	88040240 Wiring Instructions
DRAFT BY: ATS/JM	DATE: 03/05/13			
DRAFTING APPROVAL: DDF	DATE: 3/22/13		PART NUMBER:	WI88040240

REV		CHANGE DESCRIPTION	DATE	INITIALS	MATERIAL:		SCALE: FULL SCALE	INTERPOWER CORPORATION
A	INITIAL RELEASE		03/05/13	ATS/JM			SHEET 1 OF 1	