


**WIRE DETAIL**  
NOT TO SCALE

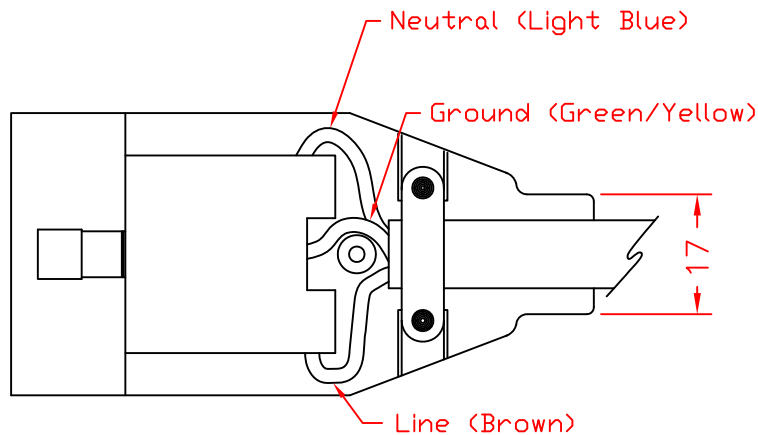

**WIRING VIEW**

- \* Use only cable with cross section 1.50 to 2.50mm<sup>2</sup> (Max. diameter 9.8mm) type H05VV-F.
- \* Prepare wires according to the 'Wire Detail' view at the left. Cable entry hole may also need preparation to accept the larger diameter cables, by trimming and enlarging the hole.
- \* Insert wires into appropriate terminal locations as demonstrated in the "Wiring View" drawing in the lower left corner. Then, remove strain relief and place cable in cradle. Replace strain relief and alternately tighten screws until adequately secure.
- \* Replace cover and secure.
- \* Connector features additional locking feature that will only function with specially designed mating plug (88040300). Connector can be used in conjunction with other plugs, but locking feature will be non-functional.

THIS DOCUMENT AND ITS CONTENTS ARE THE PROPRIETARY CONFIDENTIAL PROPERTY OF INTERPOWER CORPORATION. NO USE OR COPIES MAY BE MADE WITHOUT WRITTEN PERMISSION FROM INTERPOWER CORPORATION.

DIMENSIONS IN MILLIMETERS

TITLE 20A Brazilian Cable Connector Wiring Instruction

DRAFT BY: DDF DATE: 2/8/11

PART NUMBER: WI88040310

DRAFTING APPROVAL: DATE:

MATERIAL:

DO NOT SCALE

INTERPOWER CORPORATION

SHEET 1 OF 1

REV	CHANGE DESCRIPTION	DATE	INITIALS
A	Creation of wiring instruction.	2/8/11	DDF